


**FEATURES:**

- Utilizes same components as the figure 106/1106 Swing Check Valves
- 200 psi Working Pressure
- 400 psi Test Pressure
- Available in sizes:
  - 4 x 6, 4 x 8, 6 x 8, 6 x 10, 8 x 10, 8 x 12, 10 x 12
- Available in the following configurations:
  - Figure 1306 – Bronze Seated (Plain)
  - Figure 1306LW – Bronze Seated (with Lever & Weight)
  - Figure 1306A – Resilient Seated (Plain)
  - Figure 1306AW – Resilient Seated (with Lever & Weight)

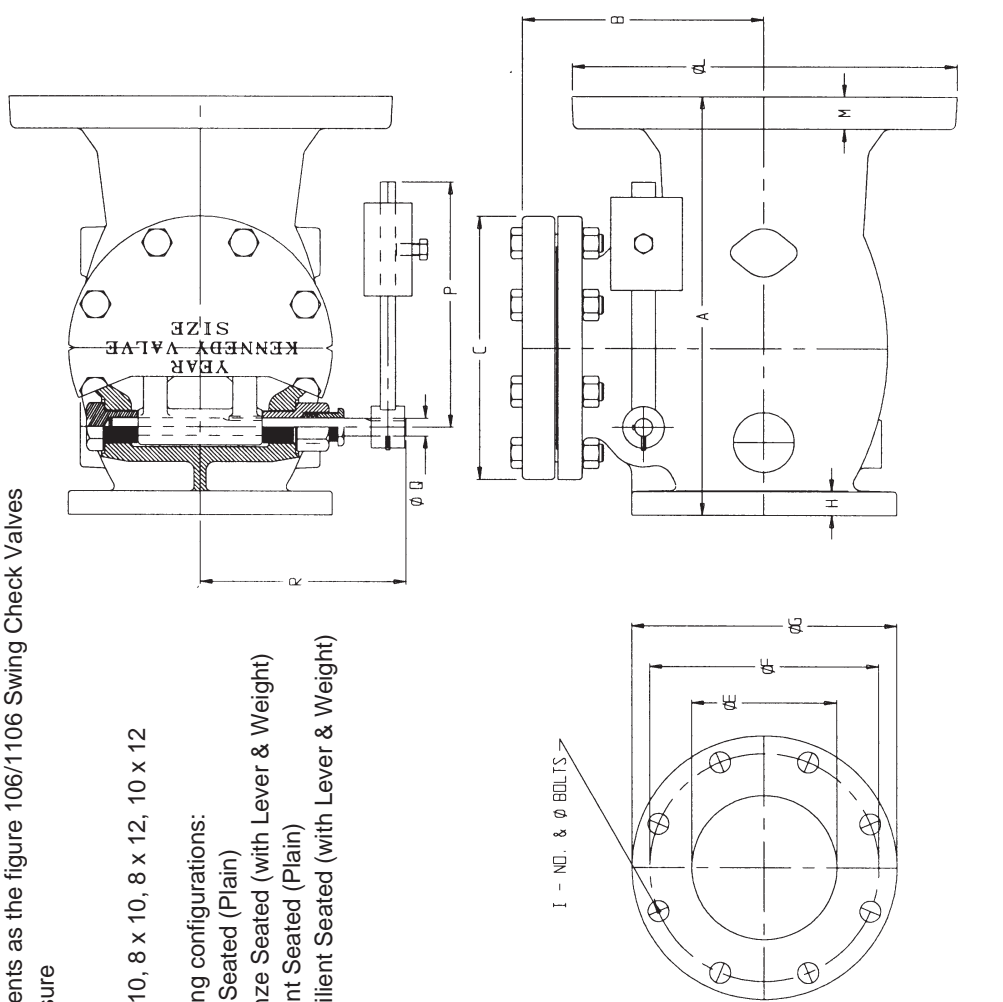


SIZE	A	B	C	D	E	F	G	H APPROX.	I	J	K	L	M	N	P	Q	R
4X6	13.50	8.31	9	10.1	4	7.50	9	0.94	8-0.63	6	9.50	11	1	8-0.75	8.25	0.63	8.19
4X8	15	8.31	9	10.1	4	7.50	9	0.94	8-0.63	8	11.75	13.50	1.13	8-0.75	8.25	0.63	8.19
6X8	17	10.06	11	10.9	6	9.50	11	1	8-0.75	8	11.75	13.50	1.13	8-0.75	10.25	0.75	9.00
6X10	17.50	10.06	11	10.9	6	9.50	11	1	8-0.75	10	14.25	16	1.19	12-0.88	10.25	0.75	9.00
8X10	20	12.38	13.50	12.4	8	11.75	13.50	1.13	8-0.75	10	14.25	16	1.19	12-0.88	14.5	0.88	10.19
8X12	21	12.38	13.50	12.4	8	11.75	13.50	1.13	8-0.75	12	17	19	1.25	12-0.88	14.5	0.88	10.19
10X12	22.50	13.93	16.75	14.7	10	14.25	16	1.19	12-0.88	12	17	19	1.25	12-0.88	18	1.00	11.63

INCREASING CHECK DIMENSIONS  
W/LEVER & WEIGHT


  
 DRAWN BY PMP  
 CHECKED  
 APPROVED  
 DATE 5-2-01  
 SCALE NONE  
 DWG NO. 31946  
 REV.

**FEATURES:**

- Utilizes same components as the figure 106/1106 Swing Check Valves
- 200 psi Working Pressure
- 400 psi Test Pressure
- Available in sizes: 4 x 6, 4 x 8, 6 x 8, 6 x 10, 8 x 10, 8 x 12, 10 x 12
- Available in the following configurations:
  - Figure 1306 – Bronze Seated (Plain)
  - Figure 1306LS – Bronze Seated (with Lever & Spring)
  - Figure 1306A – Resilient Seated (Plain)
  - Figure 1306AS – Resilient Seated (with Lever & Spring)

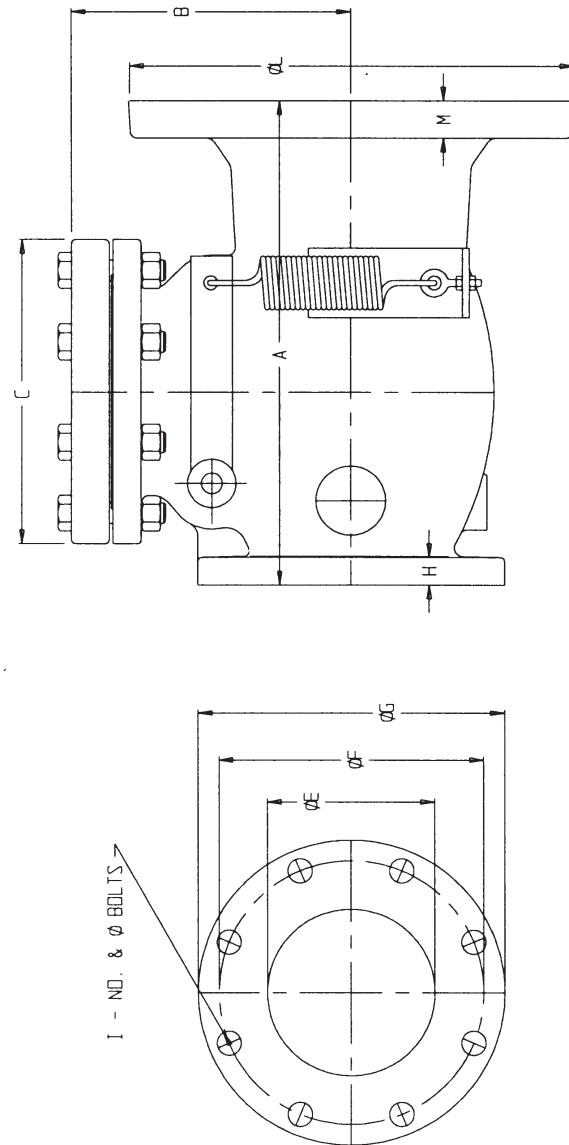

N - NO. & ø BOLTS →

SIZE	A	B	C	D	E	F	G	H	I	J	K	L	M	N
4X6	13.50	8.31	9	8.19	4	7.50	9	0.94	8-0.63	6	9.50	11	1	8-0.75
4X8	15	8.31	9	8.19	4	7.50	9	0.94	8-0.63	8	11.75	13.50	1.13	8-0.75
6X8	17	10.06	11	9	6	9.50	11	1	8-0.75	8	11.75	13.50	1.13	8-0.75
6X10	17.50	10.06	11	9	6	9.50	11	1	8-0.75	10	14.25	16	1.19	12-0.88
8X10	20	12.38	13.50	10.19	8	11.75	13.50	1.13	8-0.75	10	14.25	16	1.19	12-0.88
8X12	21	12.38	13.50	10.19	8	11.75	13.50	1.13	8-0.75	12	17	19	1.25	12-0.88
10X12	22.50	13.93	16.75	11.63	10	14.25	16	1.19	12-0.88	12	17	19	1.25	12-0.88

INCREASING CHECK DIMENSIONS  
W/SPRING & LEVER

DRAWN BY PMP  
CHECKED  
APPROVED

DATE 5-2-01  
SCALE NONE

DWG NO. 31935  
REV.

